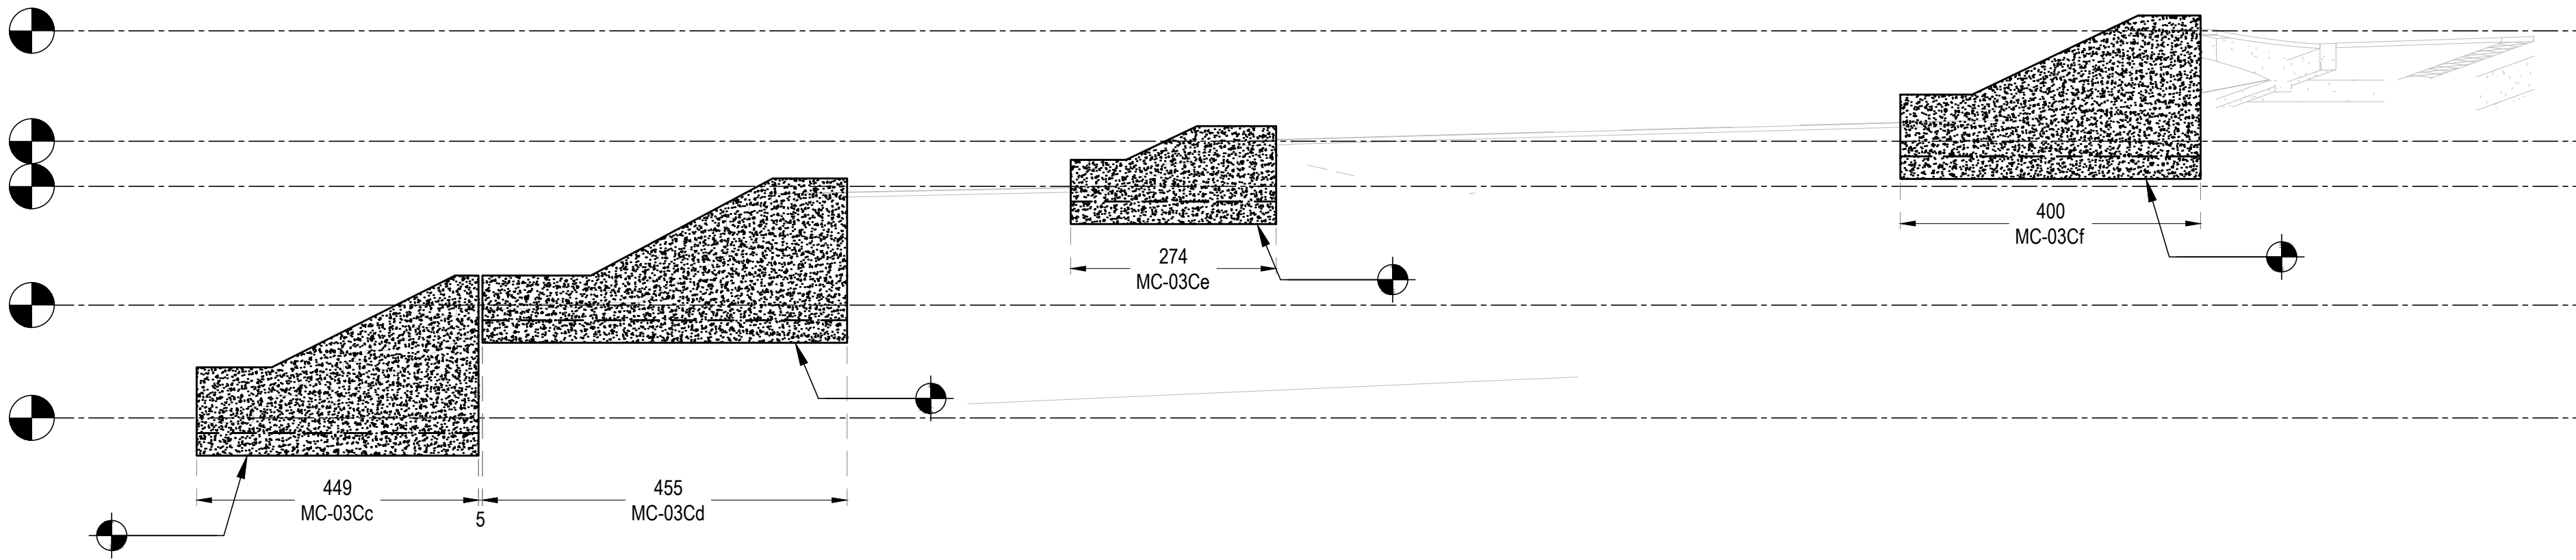


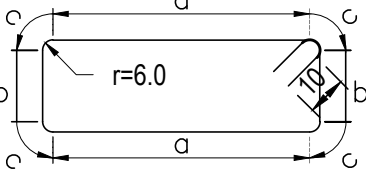
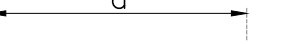
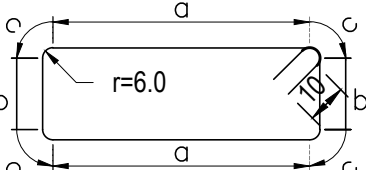
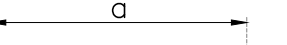
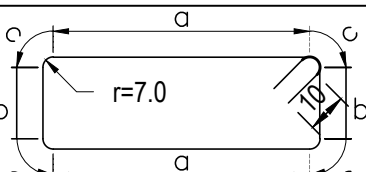
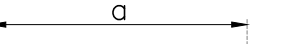
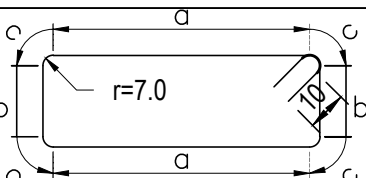
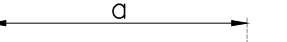
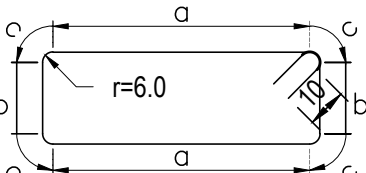
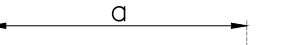
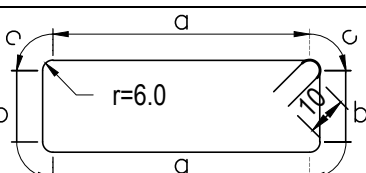
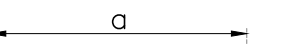
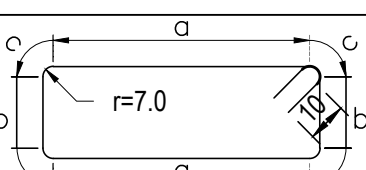
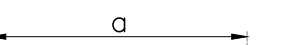
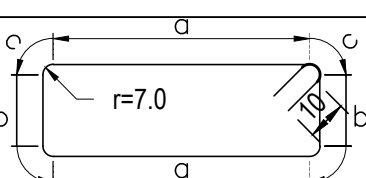
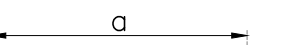


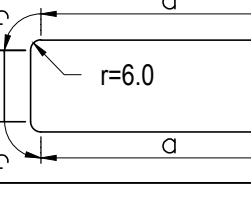
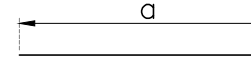
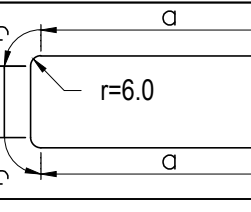
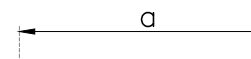
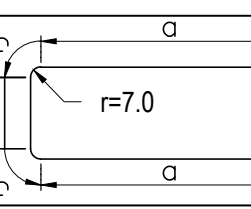
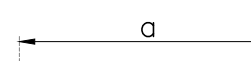
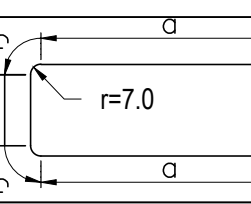
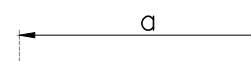
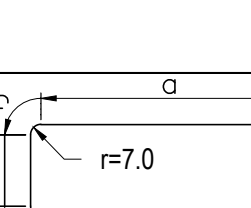
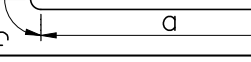
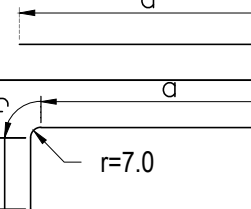
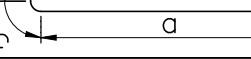
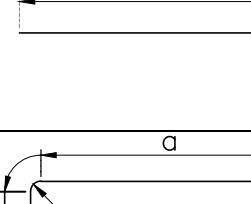
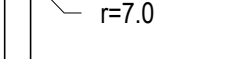
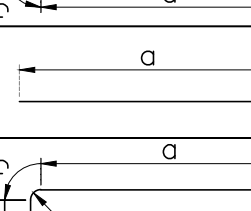
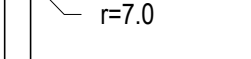
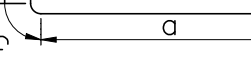
Vo.Bo. POR:

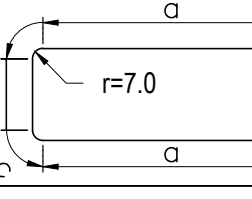
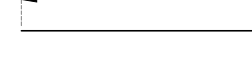
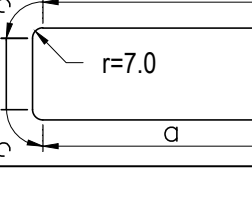
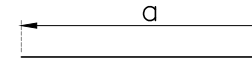
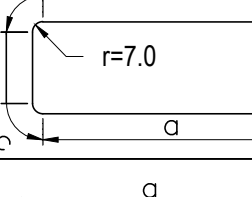
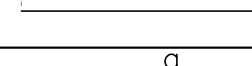
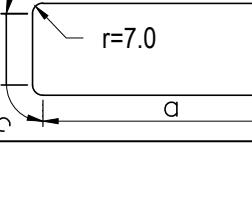
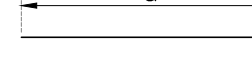
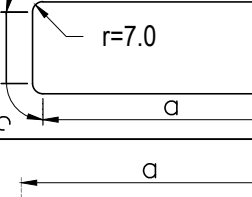
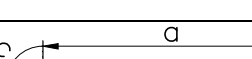
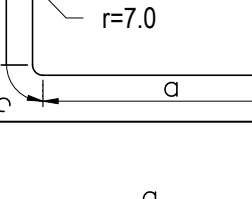
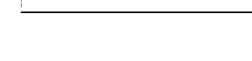
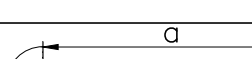
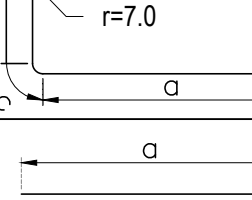
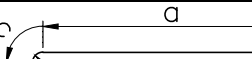
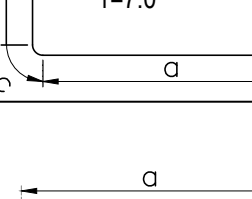
ING. MIGUEL SÁNCHEZ
ESPECIALISTA EN GEOTECNIA

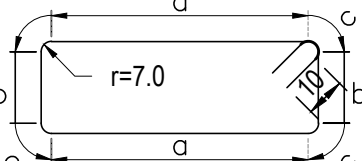
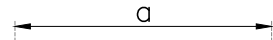
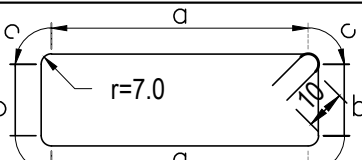
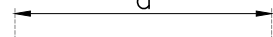
Vo.Bo. POR:

ARQ. ROGER SOLANO ACOSTA
ESPECIALISTA URBANISMO

LISTA DE VARILLAS							
LOC.	DIAM.	NUM.	LONG. TOTAL	CROQUIS	a	b	c
MURO ZC-01a ZAPATA	5c #16M	14	265		85	15	9
	5c #16M	12	265		265	-	-
MURO ZC-01a MURO	5c #16M	14	285		105	5	9
	5c #16M	8	265		265	-	-
JARDINERA a LOSA	6c #20M	50	435		160	10	11
	6c #20M	15	994		994	-	-
JARDINERA a MUROS	6c #20M	2 PAQ. DE 50 = 100	M=395 m=189 i=5.7		M=140 m=47 i=2.85	10	11
	6c #20M	2 PAQ. DE 2 = 4	994		994	-	-
	5c #16M	12	994		994	-	-
MURO ZC-01b ZAPATA	5c #16M	8	265		85	15	9
	5c #16M	12	154		154	-	-
MURO ZC-01b MURO	5c #16M	8	245		85	5	9
	5c #16M	6	154		154	-	-
JARDINERA b LOSA	6c #20M	21	435		160	10	11
	6c #20M	15	394		394	-	-
JARDINERA b MUROS	6c #20M	2 PAQ. DE 21 = 42	M=321 m=295 i=5.0		M=113 m=100 i=2.5	10	11
	6c #20M	2 PAQ. DE 2 = 4	394		394	-	-
	5c #16M	16	394		394	-	-

LISTA DE VARILLAS							
LOC.	DIAM.	NUM.	LONG. TOTAL	CROQUIS	a	b	c
MURO ZC-01c ZAPATA	5c #16M	10	265		85	15	9
	5c #16M	12	181		181	-	-
MURO ZC-01c MURO	5c #16M	10	245		85	5	9
	5c #16M	6	181		181	-	-
JARDINERA c LOSA	6c #20M	68	315		110	10	11
	6c #20M	13	1353		1353	-	-
JARDINERA c MUROS	6c #20M	2 PAQ. DE 68 = 136	M=281 m=255 i=26		M=93 m=80 i=13	10	11
	6c #20M	2 PAQ. DE 2 = 4	1353		1353	-	-
	5c #16M	12	1353		1353	-	-
JARDINERA d LOSA	6c #20M	28	315		110	10	11
	6c #20M	13	552		552	-	-
JARDINERA d MUROS	6c #20M	2 PAQ. DE 28 = 56	229		67	10	11
	6c #20M	2 PAQ. DE 2 = 4	586		586	-	-
	5c #16M	12	586		586	-	-
MC-03Ca ZAPATA	6c #20M	26	355		130	10	11
	4c #12M	10	374		374	-	-
MC-03Ca MURO	6c #20M	26	M=515 m=229 i=11.44		M=210 m=67 i=5.72	10	11
	4c #12M	12	374		374	-	-
	6c #20M	2	374		374	-	-

LISTA DE VARILLAS							
LOC.	DIAM.	NUM.	LONG. TOTAL	CROQUIS	a	b	c
MC-03Cb ZAPATA	6c #20M	18	355		130	10	11
	4c #12M	10	254		254	-	-
MC-03Cb MURO	6c #20M	18	M=515 m=229 i=5.30		M=157 m=112 i=2.65	10	11
	4c #12M	10	254		254	-	-
	6c #20M	2	254		254	-	-
MC-03Cc ZAPATA	6c #20M	31	355		130	10	11
	4c #12M	10	443		443	-	-
MC-03Cc MURO	6c #20M	31	M=533 m=289 i=8.12		M=219 m=97 i=4.06	10	11
	4c #12M	12	443		443	-	-
	6c #20M	2	443		443	-	-
MC-03Cd ZAPATA	6c #20M	31	355		130	10	11
	4c #12M	10	449		449	-	-
MC-03Cd MURO	6c #20M	31	M=493 m=233 i=8.66		M=199 m=69 i=4.33	10	11
	4c #12M	10	449		449	-	-
	6c #20M	2	449		449	-	-
MC-03Ca ZAPATA	6c #20M	18	355		130	10	11
	4c #12M	10	268		268	-	-
MC-03Ce MURO	6c #20M	18	M=315 m=225 i=5.30		M=110 m=65 i=2.65	10	11
	4c #12M	8	268		268	-	-
	6c #20M	2	268		268	-	-

LISTA DE VARILLAS							
LOC.	DIAM.	NUM.	LONG. TOTAL	CROQUIS	a	b	c
MC-03Cf ZAPATA	6c #20M	27	355		130	10	11
	4c #12M	10	394		394	-	-
MC-03Cf MURO	6c #20M	27	M=489 m=279 i=8.08		M=197 m=92 i=4.04	10	11
	4c #12M	12	394		394	-	-
	6c #20M	2	394		394	-	-